

OPERATION FOR SOFTWARE INSTALL

SUPPORTS THE FOLLOWING OPERATING SYSTEM:

- WINDOWS 98SE
- WINDOWS ME
- WINDOWS 2000
- WINDOWS XP (32 & 64 BIT)
- WINDOWS SERVER 2003 (32 & 64 BIT)
- WINDOWS SERVER 2008 / 2008 (32 & 64 BIT)
- WINDOWS VISTA (32 & 64 BIT)
- WINDOWS 7 (32 & 64 BIT)
- WINDOWS 8 (32&64 BIT) / (WINDOWS10)

Step-By-Step:


1. Install PC-LINK software.



2. Install USB driver.



3. Restart PC.
4. Put the USB cable to the PC USB port.
5. PC detected the COM. (Make sure the COM port number do not exceed 30)

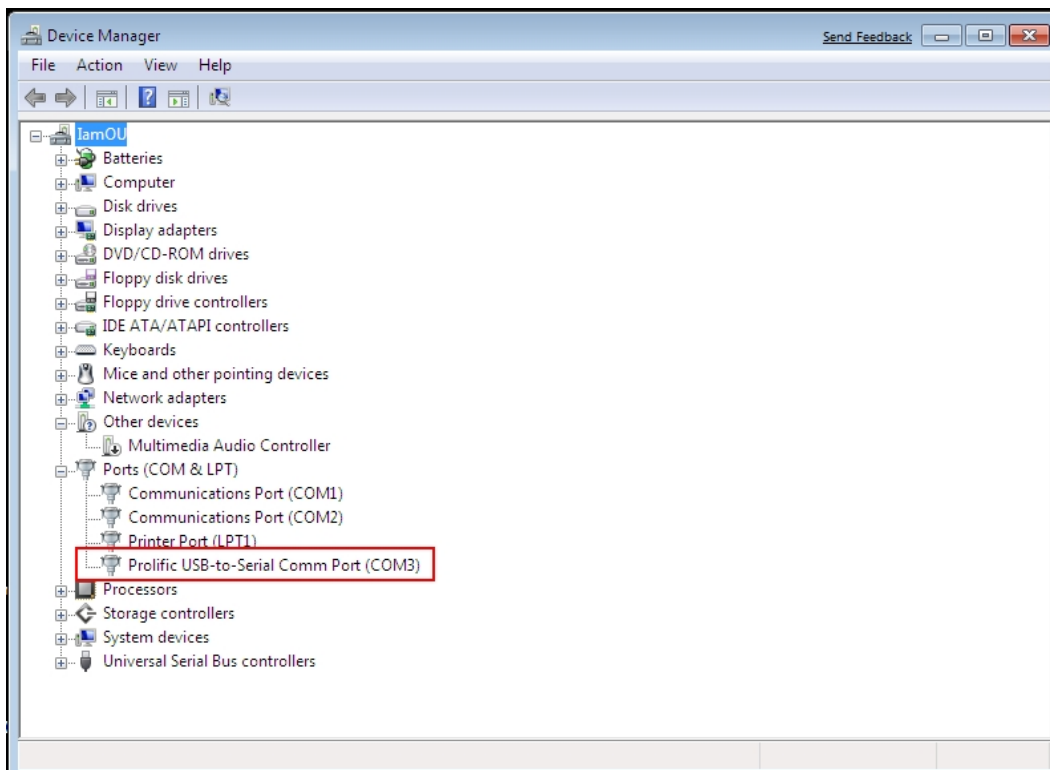


6. Run the PC-LINK software.


7. Connect with USB cable and DMM(meter).
8. Turn on the DMM and act the PC-LINK function.
9. Press the start button in the PC-LINK software.
10. Press confirm button at the pop windows.

Notice:

- Ø Login with Administrators right in PC system.

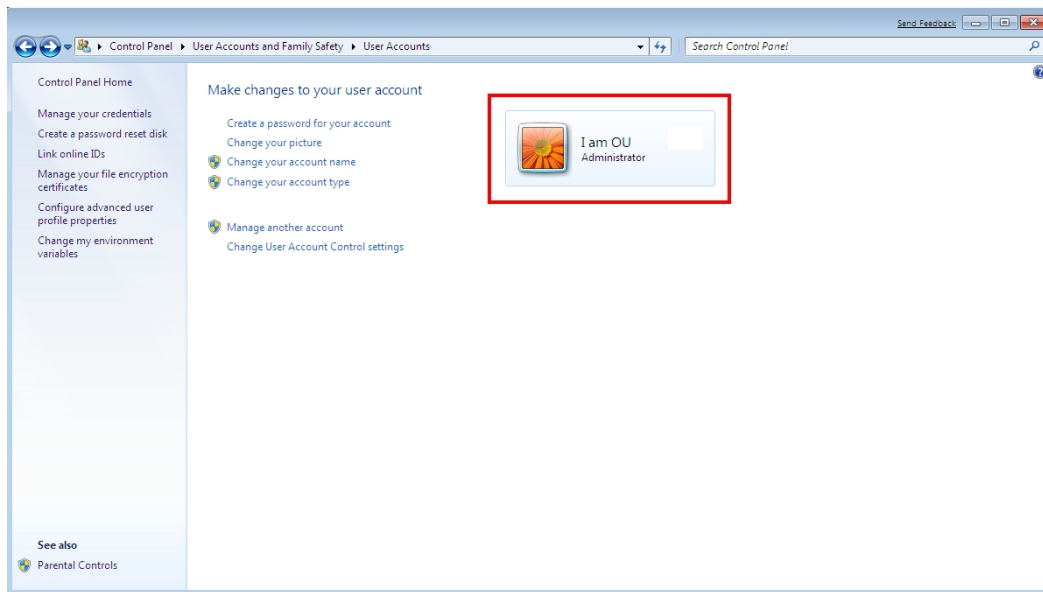

- Ø If in the Windows Vista/Windows 7 system, must be disable UAC(User Account Control) function.

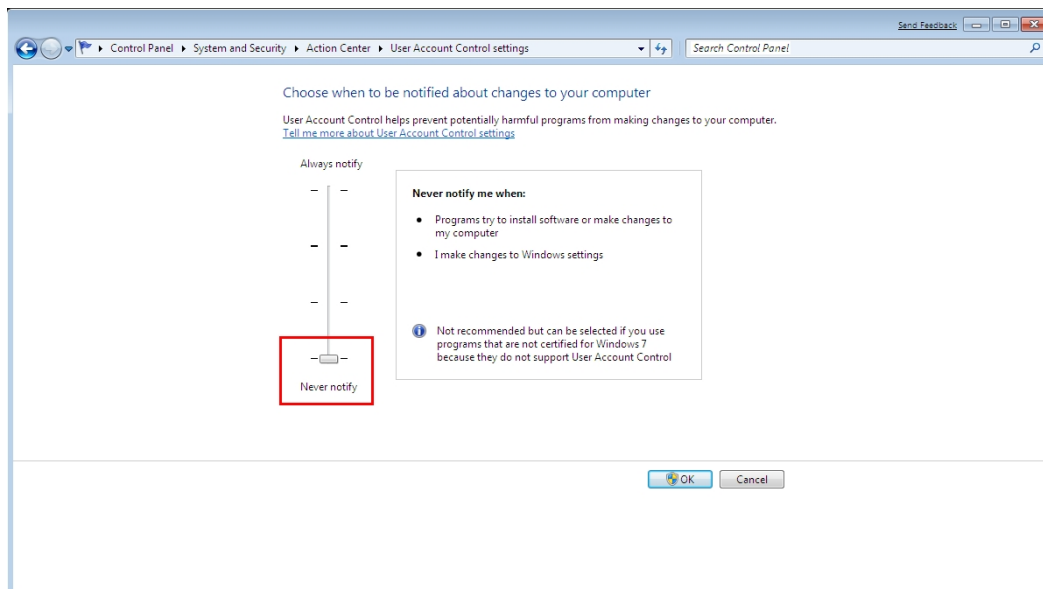

- Ø Make sure the USB cable is have a good connection with the DMM.